CLASSIFIED MESSAGE  DATE 1820Z 05 OCT 62 SECRET	ROUTING  1	
TO : DIRECTOR  25X1  FROM :	26191 AB PROPERTIES IN 50962	
25X1 25X1 TO PRITY INFO PRITY	CITE	25X*

REPORT AS OF EVENING OCTOBER 4

- EXTENSION SHAFT TO REMOTE GEARBOX ON 202 HAS HAD ADDITIONAL CLEARANCE GROUND IN AT BOTH ENDS OF SHAFT IN ORDER TO PROVIDE ADDITIONAL FREEDOM OF MOVEMENT NECESSITATED BY DIFFERENCE IN ANGULAR DEFLECTION WITH WING UP AND WING DOWN AND DUE TO FACT ENGINE IS INSTALLED IN THIS PARTICULAR ARTICLE 1/8 INCH FORWARD OF ORIGINAL PLANNED MOUNT LOCATION. THIS WORK HAS BEEN COMPLETED AND ENGINE BEING REINSTALLED WITH A GROUND RUN PLANNED FOR OCTOBER 5.
- NBR 201 AFTER FURTHER ADJUSTMENT OF PT2 RATE ADJUSTMENT IN ADDITION TO ADJUSTMENT OF PT2 POSITION ADJUSTMENT, NOW APPEARS TO HAVE ACHIEVED GOOD STABILITY. IT WILL REMAIN ON THE STAND TO INVESTIGATE, AS NECESSARY, PROBLEMS WHICH MAY APPEAR IN ARTICLE X AND UNTIL RECEIPT OF INSTRUMENTED BURNER PRESSURE LINE AND NEW MANIFOLD LINES. THE FIRST OF THESE IS EN ROUTE TO NOW

SECRET

GROUP 1 EXCLUDED FROM AUTOMATI

REPRODUCTION BY OTHER THAN THE ISSUING OFFICE IS PROHIBITED

25X1

·		SECRET	'	
	(IN 50962)		PAGE TWO	
AND THE LAT	TER LINES ARE BEIN	G MADE UP AT	ON AN URGENT	
BASIS TO AC	HIEVE GREATER CLEA	ARANCE FROM THE	CLEVON TORQUE TUBE.	
EST IMATED A	VAILABILITY EARLY	THIS NEXT WEEK.		
3. NBR	203 has had its fu	JEL CONTROL RETUR	ENED TO	7
	S WHICH HAVE NOW E	BEEN REPAIRED AND	CONTROL IS BEING	<i>!</i>
	ON BOTH THE BENCH	AND AN ENGINE	SEFORE RETURN TO	
;				
4. TWO	J75°S WERE INSTALL	ED IN ARTICLE NE	R 123 AND CHECKED	
OUT ON GROU	ND RUN SATISFACTOR	RILY BUT AFTER SH	IUTDOWN FOUND	
FOREIGN OBJ	ect damage on left	ENGINE WHICH IS	CURRENTLY BEING	
REPLACED.	·	•	<u>.</u>	-
	AND THE LAT BASIS TO AC ESTIMATED A  3. NBR DUE TO LEAK 1 CHECKED OUT 4. TWO OUT ON GROU FOREIGN OBJ	AND THE LATTER LINES ARE BEING BASIS TO ACHIEVE GREATER CLEAR ESTIMATED AVAILABILITY EARLY  3. NBR 203 HAS HAD ITS FUR DUE TO LEAKS WHICH HAVE NOW BE CHECKED OUT ON BOTH THE BENCH CHECKED OUT ON BOTH THE BENCH OUT ON GROUND RUN SATISFACTOR FOREIGN OBJECT DAMAGE ON LEFT	SECRET  (IN 50962)  AND THE LATTER LINES ARE BEING MADE UP AT	AND THE LATTER LINES ARE BEING MADE UP AT ON AN URGENT BASIS TO ACHIEVE GREATER CLEARANCE FROM THE ELEVON TORQUE TUBE.  ESTIMATED AVAILABILITY EARLY THIS NEXT WEEK.  3. NBR 263 HAS HAD ITS FUEL CONTROL RETURNED TO OUE TO LEAKS WHICH HAVE NOW BEEN REPAIRED AND CONTROL IS BEING CHECKED OUT ON BOTH THE BENCH AND AN ENGINE BEFORE RETURN TO OUT ON GROUND RUN SATISFACTORILY BUT AFTER SHUTDOWN FOUND FOREIGN OBJECT DAMAGE ON LEFT ENGINE WHICH IS CURRENTLY BEING

END OF MESSAGE

Approved For Release 2004/05/13 : CIA-RDP89B00980R000300070113-0